

PolTolerances-AC

Dimensions, tolerances and fits for plastic moulded parts

User Manual

“Dimensions, tolerances and fits” tab

Described using PolTolerances-AC 3.0.2.0 · As of: October 2026

Makrolar GbR Berlin

Contents

Contents	2
1 Introduction.....	3
2 User interface	3
3 Creating a new project	4
3.1 General project information.....	4
3.2 Selecting the application condition	5
3.3 Defining the tolerance group	6
3.4 Finish.....	6
4 The project view	6
5 Entering dimensions	8
5.1 Independent dimension	8
5.2 Fit dimension	9
6 Managing application conditions	12
6.1 Creating a new application condition.....	12
7 Printing and help	13
7.1 Printing / Print Preview	13
7.2 Abbreviations.....	14
8 Menus.....	15
9 Tips and frequently asked questions.....	15

1 Introduction

Plastic moulded parts change their dimensions in service: through thermal expansion and contraction, swelling, post-shrinkage, wear or deformation. A dimension that is correct at acceptance in production may therefore be out of tolerance under the later application conditions, and a fit may jam or get too much clearance.

The “**Dimensions, tolerances and fits**” tab of PolTolerances-AC converts dimensions and fits between two states:

- **FAC – Fabrication Acceptance Condition:** the state at acceptance of the moulded part (stored at $23^{\circ}\text{C} \pm 2\text{ K}$ and $50\% \pm 10\%$ relative humidity, inspected no earlier than 16 and no later than 72 hours after manufacturing).
- **AC – Application conditions:** all operating and storage conditions during the period of use, insofar as they affect dimensional accuracy and functional performance.

You create a project for a moulded part, assign an application condition and a tolerance group to it, and then enter **independent dimensions** and **fit dimensions**. For each dimension, PolTolerances-AC shows the values under FAC and AC, the possible production deviations according to DIN ISO 20457 and, for fits, the clearance or oversize in both states.

Note: The other tabs on the left edge of the window (“**Manufacturing tolerances according to DIN ISO 20457 / DIN 16742**”, “**Commercial products plus**” and “**Logging**”) are not described in this manual. Manufacturing tolerances and commercial products each have a manual of their own.

2 User interface

After start-up, the “**Dimensions, tolerances and fits**” tab shows the start page with three buttons.

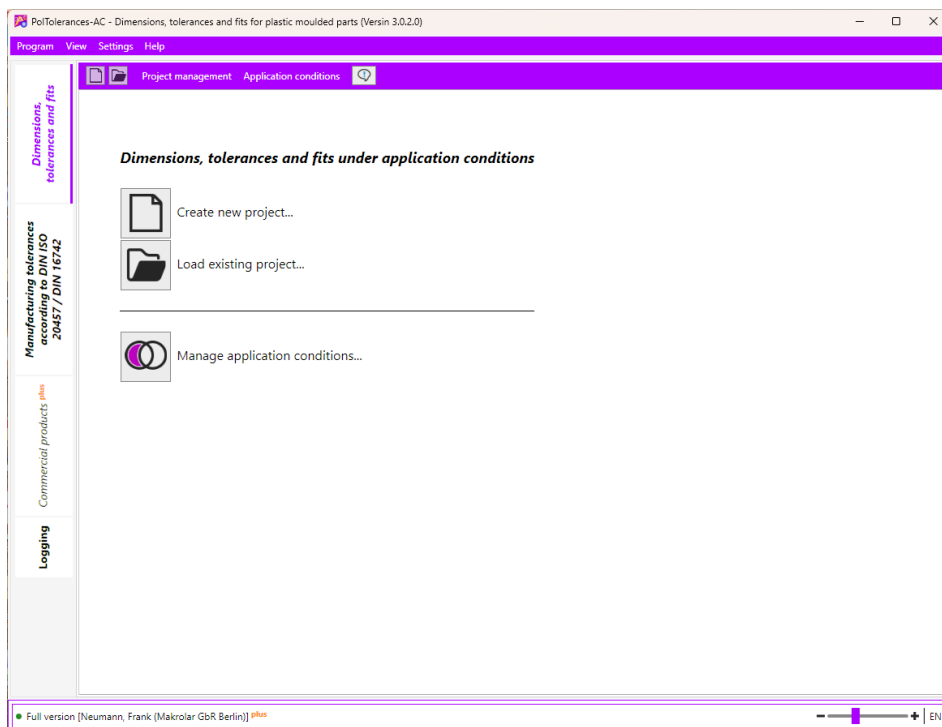


Figure 1: Start page of the “Dimensions, tolerances and fits” tab

Element	Purpose
Menu bar	“Program”, “View”, “Settings” and “Help” (chapter 8).
New and Open symbols (violet bar)	Create a new project or load an existing one.
“Project management” menu	New project..., Load project..., Close all projects.
“Application conditions” menu	Manage... (chapter 6) and Printing / Print Preview... of the application conditions.
Speech bubble button	Opens the “Abbreviations” window (section 7.2).
Create new project...	Starts the project wizard (chapter 3).
Load existing project...	Opens a saved project.
Manage application conditions...	Library of application conditions (chapter 6).
Status bar	Licence status, zoom slider and user interface language (“EN”).

3 Creating a new project

Click **“Create new project...”**. A wizard guides you through the basic settings in four steps. Use **“Back”** and **“Next”** to move between the steps; **“Cancel”** discards the project.

3.1 General project information

1. Enter the **“Project or (Molded)part designation”**.
2. Optionally add a **“Description”** (with simple formatting) and **“Material specifications”**, e.g. **“PA6-GF30”**.
3. Select which case applies (see table) and click **“Next”**.

Option	Meaning
Part made of plastic , dimensions and fits under FAC and AC	The normal case: tolerance group according to DIN ISO 20457 plus conversion to the application conditions.
Part made of plastic , dimensions and fits only under FAC	Only manufacturing tolerances and fits in the acceptance state, without an application condition.
Part made of a different material (other than plastic)	Only the dimensional changes under application conditions, without a tolerance group according to DIN ISO 20457.

Figure 2: Step 1: general project information

3.2 Selecting the application condition

Click “Select Application Condition (Plastic Molding)”. The “Manage Application Conditions” window shows all existing application conditions as cards. Each card shows the **designation**, the **resulting dimensional shift** and the **resulting dimensional variation** in percent. “show more details” reveals the individual dimensional changes that make up these values.

Figure 3: Selecting an application condition; the selected card has a black frame

1. Click the matching card.
2. Click “Apply”. The wizard shows the selected condition under “currently used application condition”.
3. Click “Next”.

If no suitable application condition exists, create one in the same window via “New application condition...” (chapter 6).

Figure 4: Step 2 with the selected application condition

3.3 Defining the tolerance group

In the “**Fabrication Acceptance Condition (FAC) according to DIN ISO 20457**” step, select the tolerance group directly (TG4 to TG9) or determine it via “**Determine the tolerance group (TG)...**”.

The “**Determine tolerance group**” dialog offers, as in PolTolerances, a “**Point evaluation**” (manufacturing process, material stiffness, processing shrinkage, differences in shrinkage) and “**Assignment help(s)**” based on the moulding compound group. The tolerance group appears on the right as soon as all information is available. “**Apply**” enters it in the wizard.

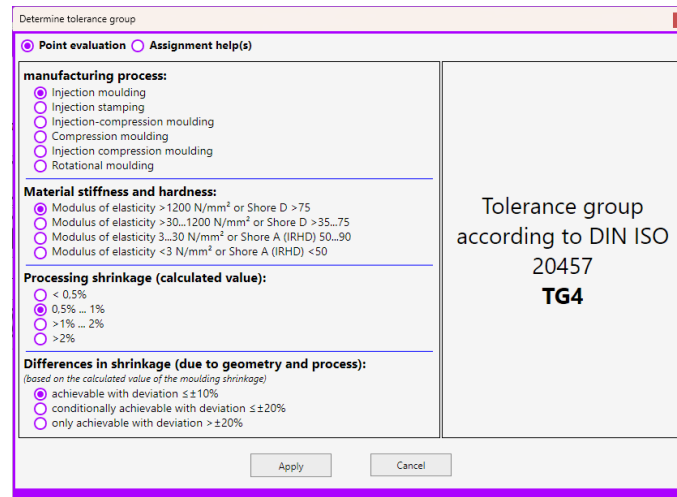


Figure 5: Determining the tolerance group by point evaluation: TG4

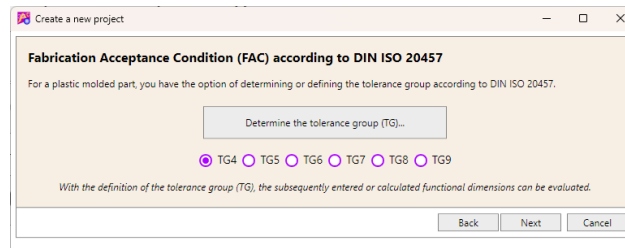


Figure 6: Step 3 with the applied tolerance group TG4

3.4 Finish

The last step confirms that the basic settings are defined and that you can now add dimensions. Click “**Finish**”. Most entries can be corrected afterwards; changes are immediately reflected in all dimensions.

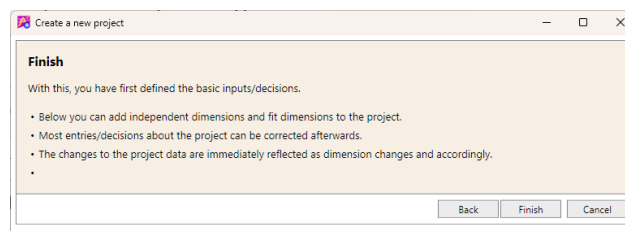


Figure 7: Step 4: Finish

4 The project view

After finishing, the project opens. The header shows its designation; below are the project settings and – once added – the dimensions as tabs of their own.

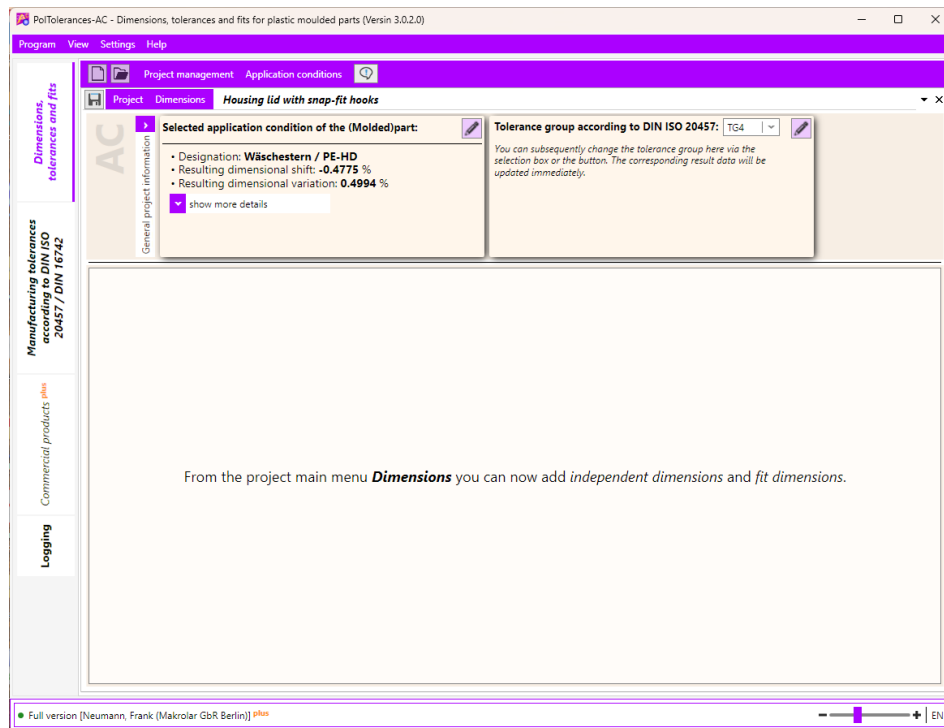


Figure 8: New project without dimensions

Element	Purpose
Disk symbol, “Project” and “Dimensions” menus	Save the project; “Project” menu: Save project, Save project as, Printing / Print Preview..., Close project . “Dimensions” menu: New independent dimension..., New fit dimension....
“General project information” flap	Expands and collapses designation, description and material specifications for editing.
“Selected application condition of the (Molded)part”	Designation, resulting dimensional shift and variation. The pencil symbol lets you choose a different application condition.
“Tolerance group according to DIN ISO 20457”	Drop-down list of the tolerance group; the pencil symbol opens “Determine tolerance group”. Changes are applied to all results immediately.
Dimension tabs	One tab per dimension, labelled with the dimension and the reference system, e.g. “120.000±0.500 mm (FAC)”. ✕ deletes, the pencil edits the dimension.
✕ at the top right	Close the project.

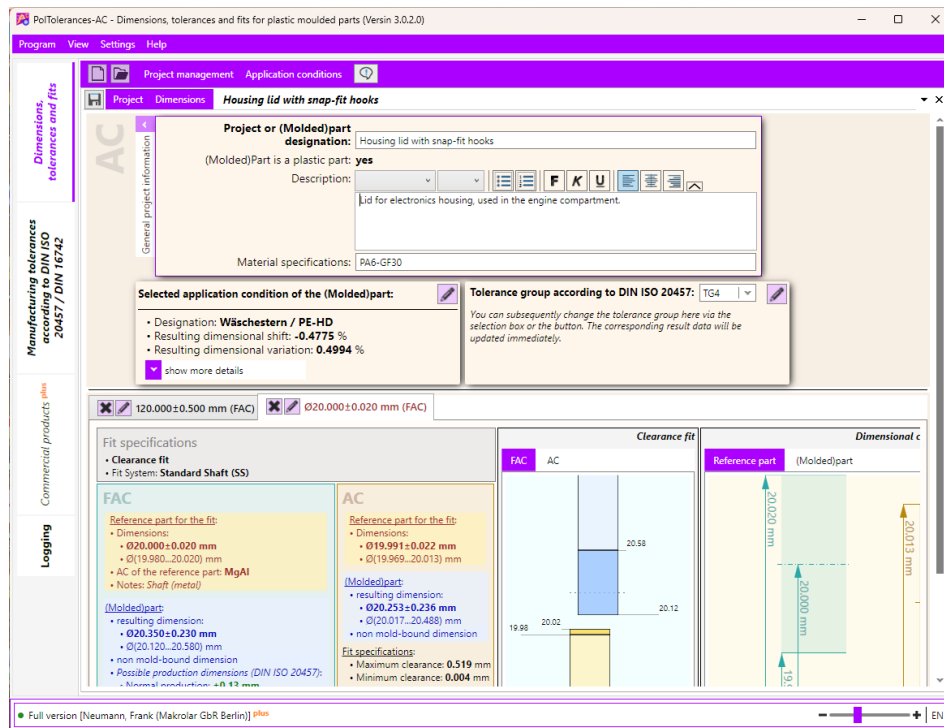


Figure 9: Expanded general project information

5 Entering dimensions

5.1 Independent dimension

An independent dimension is a single dimension of the moulded part without a mating part, e.g. a width or a length.

1. Choose “**Dimensions**” > “**New independent dimension...**”.
2. Under “**Direction of transformation**”, specify in which state you enter the dimension: **under FAC** (you receive the dimensions under AC) or **under AC** (you receive the dimensions under FAC). Click “**Next**”.
3. Select “**Diameter dimension**” or “**Other dimension**” and enter “**Center dimension [mm]**” and “**Functionally required dimension [$\pm$ mm]**”.
4. Tick “**Wall thickness**” or “**mold-bound dimension**” if applicable and add “**Notes**”.
5. Optional: “**Select additional application condition (for the current measurement)...**” applies a different application condition to this dimension only, e.g. for wear or deformation.
6. Click “**Next**” and then “**Finish**”.

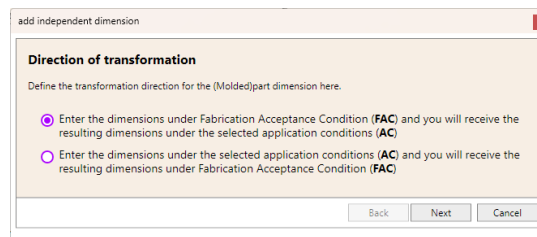


Figure 10: Specifying the direction of transformation

Figure 11: Dimensions under Fabrication Acceptance Condition: 120 mm ± 0.5 mm

The result appears as a new tab:

- **FAC** (green): the entered dimensions, whether the dimension is mold-bound, and the **possible production dimensions according to DIN ISO 20457** for normal production, accurate manufacturing, precision production and precision special production. A warning triangle marks tolerance series that have to be agreed with the manufacturer of the moulded part.
- **AC** (beige): the dimensions under application conditions, i.e. shifted by the dimensional shift and widened by the dimensional variation.
- **“Dimensional change (variation and shift)”** chart: position and width of the tolerance zone under FAC and AC with center, maximum and minimum dimension.

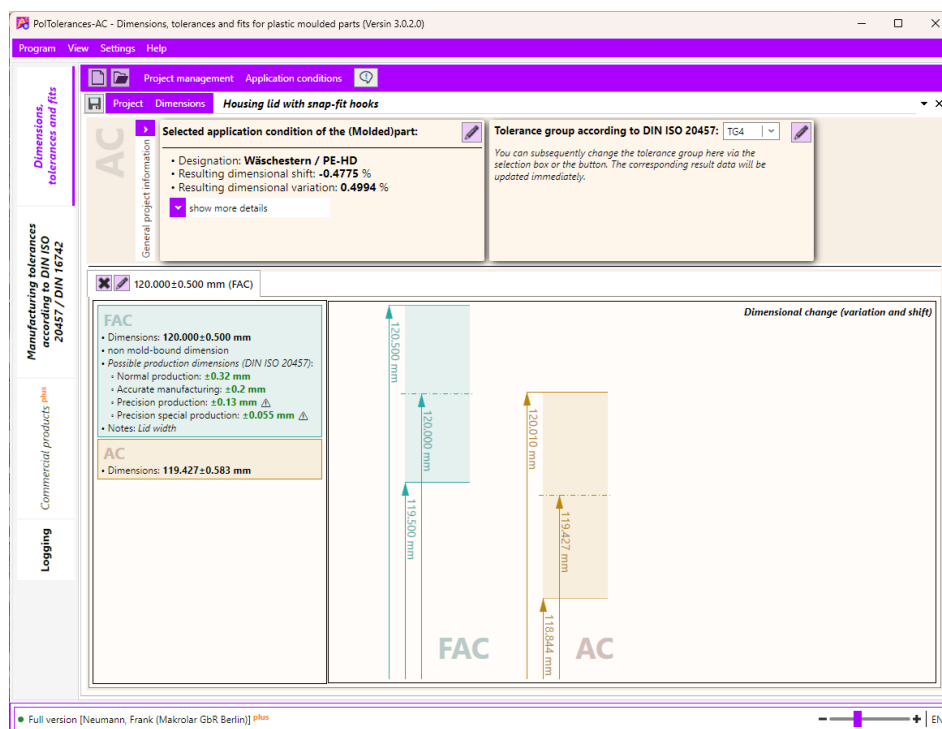


Figure 12: Independent dimension: 120.000 ± 0.500 mm under FAC becomes 119.427 ± 0.583 mm under AC

5.2 Fit dimension

A fit dimension describes how the moulded part interacts with a mating part (fit reference part), e.g. a bore in the plastic part on a metal shaft. PolTolerances-AC calculates the matching part dimension from the required clearance or oversize and checks the fit under application conditions, where moulded part and reference part may change differently.

1. Choose **“Dimensions”** › **“New fit dimension...”** and specify the **“Direction of transformation”** (as in section 5.1).
2. **Fit Reference Part / Dimensional Reference System:** tick that the dimensions of the fit cover part under FAC are also known. Both parts must be available in the same dimensional reference system.
3. **Application condition (AC) of the reference part for the fit:** tick that it is **identical** to that of the moulded part (same material), or choose a separate one via **“Select the application condition (AC) of the reference part for the fit...”**, e.g. for a metal part.
4. **Dimensions for (Molded)part and partner fitting:** select **“Diameter dimension”** or **“Other dimension”**, mark a tool-bound dimension if applicable and enter **center dimension**, **functionally required dimension** and **notes** of the partner fitting. Tick whether the partner fitting is the **enclosing part** of the fit; this determines the fit system (**Standard Shaft** or **Standard Hole**).
5. **Type and dimensioning of the fit:** select **“Clearance fit”** or **“Interference fit”** and enter maximum and minimum clearance or maximum and minimum oversize. The mean clearance and the **resulting dimensions** of the moulded part are calculated immediately and shown graphically on the right.
6. Click **“Next”** and then **“Finish”**.

Fit

Fit Reference Part / Dimensional Reference System

When the fit is subsequently determined, the dimensions of the fitting parts must be available in the same dimensional reference system (under Fabrication Acceptance Condition FAC).

☒ The dimensions of the **fit cover part** (under Fabrication Acceptance Condition **FAC**) are also known.

Back Next Cancel

Figure 13: Fit reference part and dimensional reference system

Fit

Application condition (AC) of the reference part for the fit

Set the application condition (AC) for the reference part for the fit here.

☐ the application condition (AC) of the fit reference part is **identical** to that of the (molded) part.
Select this option if the **material** of the **fit reference part** is **identical** to that of the **(molded) part**.

Select the application condition (AC) of the reference part for the fit ...

Application condition of the reference part for the fit

- Designation = **MgAl**
- resulting dimensional displacement = **0.0432 %**
- Resulting dimensional variation = **0.0945 %**

Back Next Cancel

Figure 14: Separate application condition “MgAl” for the metal reference part

Fit

Dimensions for (Molded)part and partner fitting

First, enter the basic dimensions of the (Molded)part. And you need to determine the exact dimensions of the partner fitting part (fitting cover part).

Please note: Your following entries/decisions apply under **Fabrication Acceptance Condition (FAC)**.

☒ **Diameter dimension** ☐ **Other dimension**

☐ (Molded)Partial dimension is a 'tool-bound' dimension

Partner Fitting (Fitting Cover for the Fitting System)

Ø Center dimension [mm]: 20

Functionally required dimension [±mm]: 0.02

Notes: Shaft (metal)

☐ the partner fitting part is the enclosing part of the fit

Fit System: **Standard Shaft (SS)**

Back Next Cancel

Figure 15: Partner fitting: shaft Ø 20 ±0.02 mm, fit system Standard Shaft

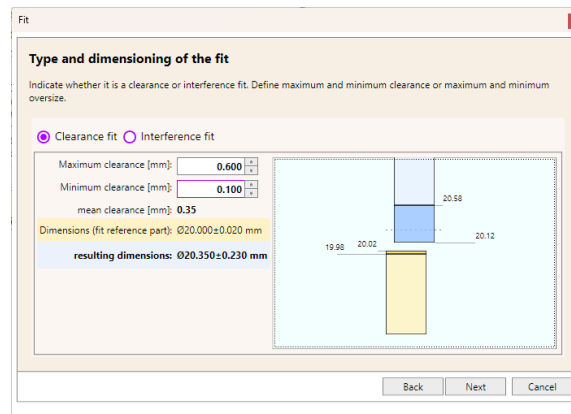


Figure 16: Clearance fit with 0.1 ... 0.6 mm clearance: bore in the moulded part $\varnothing 20.350 \pm 0.230$ mm

The tab of the fit shows:

- **“Fit specifications”**: type of fit and fit system.
- **FAC column**: dimensions and application condition of the reference part, the resulting dimension of the moulded part with the possible production dimensions according to DIN ISO 20457, and maximum, minimum and mean clearance.
- **AC column**: the same values under application conditions. This is where you see whether the fit still works in service.
- **“Clearance fit”** or **“Interference fit”** chart with the **FAC** and **AC** tabs, and the **“Dimensional change”** chart with the **Reference part** and **(Molded)part** tabs.

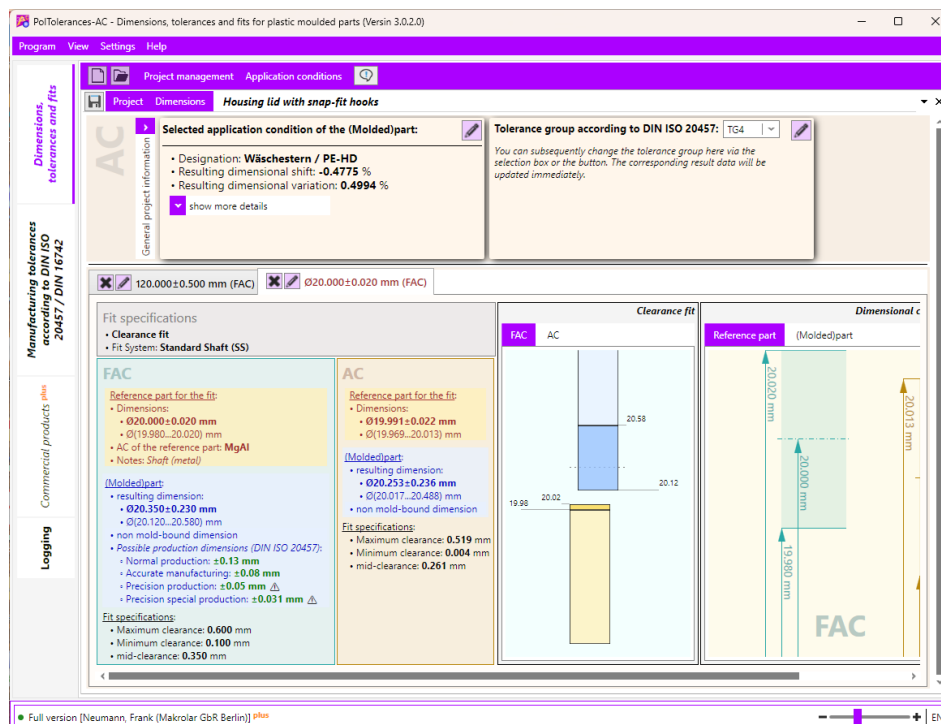


Figure 17: Result of the fit: under AC the minimum clearance drops from 0.100 mm to 0.004 mm

Tip: If the minimum clearance under AC is close to zero or negative, the fit will jam in service. Increase the minimum clearance using the pencil symbol on the tab, or choose a tighter tolerance series.

6 Managing application conditions

Application conditions are stored in a library that is shared by all projects. The path of the file is shown at the top of the window next to **“Storage folder”**. You open the library from the start page, via **“Application conditions”** > **“Manage...”** or when selecting a condition in a project.

Symbol on the card	Purpose
X	Delete the application condition.
Pencil	Edit the application condition.
Double rectangle	Clone the application condition, e.g. as a template for a similar one.
Arrow “show more details”	Shows the individual dimensional changes with direction, range and notes.

6.1 Creating a new application condition

1. Click **“New application condition...”**.
2. Enter a **“Designation”** and optionally a **“Description”**.
3. Next to **“Application-related dimensional changes”**, click **“Add...”**.
4. Select the **“Type of dimensional change”** and click **“Next”**.
5. Enter the characteristic values. PolTolerances-AC calculates the **“Result [%]”** from them.
Alternatively, click **“Next”** without input and enter the values directly.
6. In **“Summary and notes”**, check direction (dimensional increase or decrease) and minimum and maximum values, then click **“Next”** and **“Finish”**.
7. Add further dimensional changes if needed and save the application condition with **“OK”**.

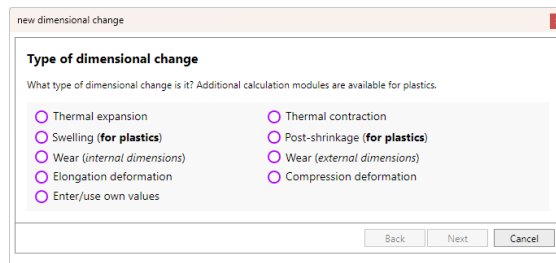


Figure 18: Selecting the type of dimensional change

Type of dimensional change	Note
Thermal expansion / thermal contraction	From the coefficient of linear thermal expansion [$10^{-6}/K$] and the maximum or minimum part temperature.
Swelling, post-shrinkage	Additional calculation modules for plastics.
Wear (internal / external dimensions)	Material removal in service.
Elongation deformation, compression deformation	Deformation under load.
Enter/use own values	Enter the dimensional change directly in percent.

new dimensional change

Thermal Expansion

With the following inputs/decisions, you can calculate the dimensional change. Alternatively, click "Next" to enter the values directly.

Coefficient of linear thermal expansion [$10^{-6}/K$]: 30

Maximum molded part temperature (>23 °C): 120

Result [%]: 0.0000 ... 0.2910

Own notes:

(generated) Notes:
Coefficient of thermal expansion / linear thermal expansion coefficient [$10^{-6}/K$] = 30
Maximum molded part temperature [°C] = 120

Back Next Cancel

Figure 19: Thermal expansion: $30 \cdot 10^{-6}/K$ up to 120 °C gives 0 ... 0.291 %

Create a new application condition

Designation: Engine compartment 120 °C

Description:

Application-related dimensional changes:

Type of dimensional change	Direction	min [%]	max [%]	Notes
Thermal Expansion	Measurement Magnification	0	0.291	Coefficient of thermal expansion / linear thermal expansion coefficient [$10^{-6}/K$] = 30 Maximum molded part temperature [°C] = 120

OK Cancel

Figure 20: New application condition with one dimensional change

7 Printing and help

7.1 Printing / Print Preview

In the project, choose **“Project”** > **“Printing / Print Preview...”**. The preview contains the project data (designation, description, material, application condition, tolerance group, creation and update date) and all fits and independent dimensions with their FAC and AC values. Use the printer symbol at the top left to print; at the bottom right you change the page view and the magnification.

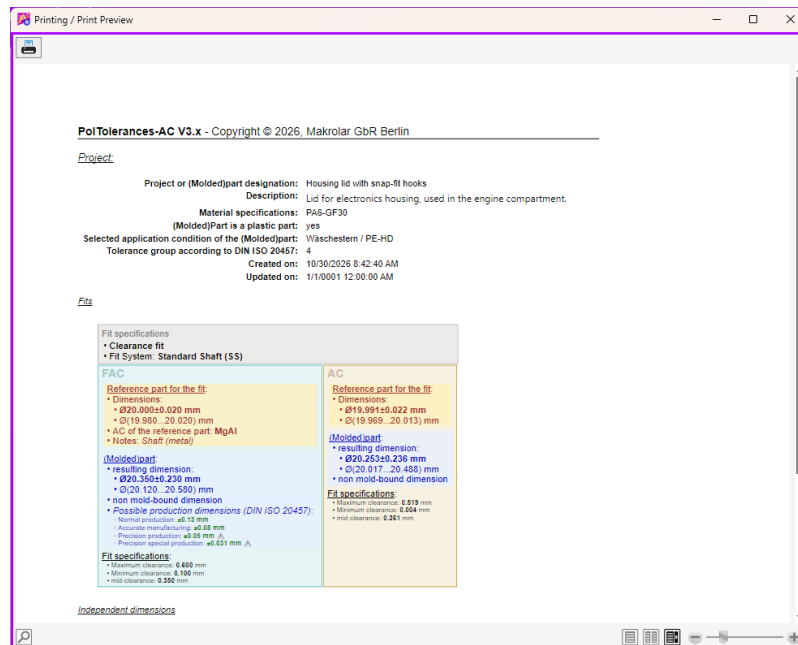


Figure 21: Print preview of a project

To print the list of all application conditions, choose **“Application conditions”** › **“Printing / Print Preview...”**.

7.2 Abbreviations

The speech bubble button in the violet bar opens the **“Abbreviations”** window:

Abbreviation	Meaning
AC	Dimensional reference system Application conditions: all operating and storage conditions during the period of use and after manufacturing, insofar as they affect dimensional accuracy and functional performance.
FAC	Dimensional reference system Fabrication Acceptance Condition: storage until acceptance at 23 °C ± 2 K and 50 % ± 10 % relative humidity, inspection no earlier than 16 and no later than 72 hours after manufacturing.
TG	Tolerance groups (TG1 to TG9): classification of the material- and process-related variation range of manufacturing tolerances for plastic moulded parts, approximating the ISO system according to DIN EN ISO 286-1 and -2.
SS	Fit system Standard Shaft: the shaft has a fixed tolerance zone; the hole is adjusted.
SH	Fit system Standard Hole: the hole has a fixed tolerance zone; the shaft is adjusted.

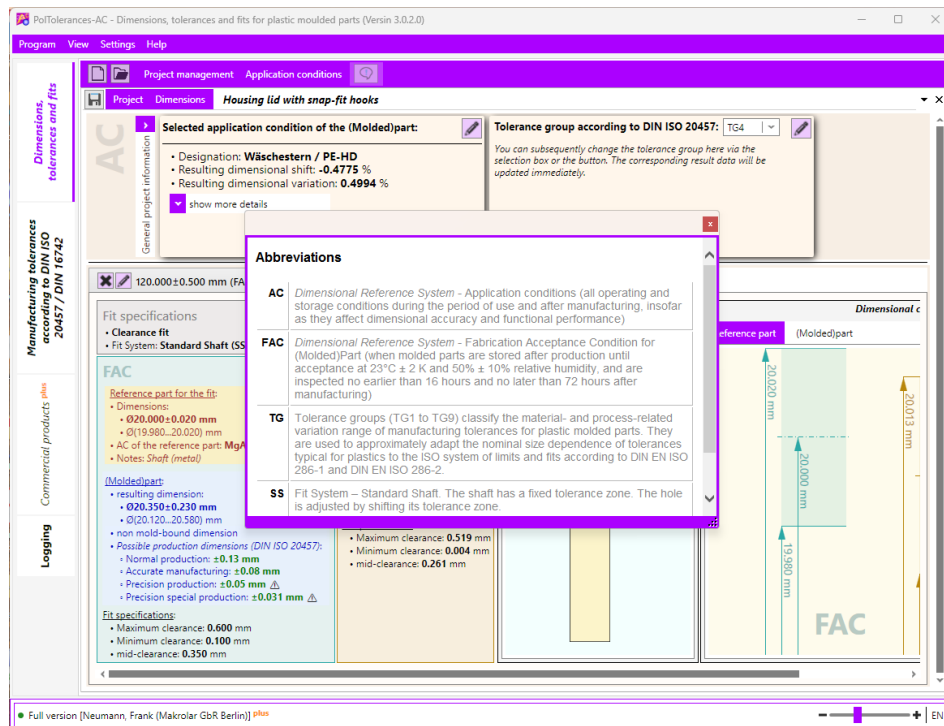


Figure 22: "Abbreviations" window

8 Menus

Menu	Commands
Program	Exit Program; Info about...
View	Switch between "Dimensions, tolerances and fits under application conditions", "Manufacturing tolerances according to DIN ISO 20457 / DIN 16742" and "Commercial products"; Original size (100%); Results Change View.
Settings	Server connection...; Activate the license...; Reset the license...; Options...; Language/Sprache...
Help	Check for software update...; To our homepage...; Register for the software...; View online help; View local help... (F1 key); View local Help (Commercial products database)...
Project management (violet bar)	New project...; Load project...; Close all projects.
Application conditions (violet bar)	Manage...; Printing / Print Preview...
Project (in an open project)	Save project; Save project as; Printing / Print Preview...; Close project.
Dimensions (in an open project)	New independent dimension...; New fit dimension...

9 Tips and frequently asked questions

Question	Answer
----------	--------

Question	Answer
What is the difference between FAC and AC?	FAC is the state at acceptance in production, AC the state in service. Tolerances according to DIN ISO 20457 apply under FAC; PolTolerances-AC converts them to AC.
Which direction of transformation should I choose?	“Enter under FAC” if you know the drawing dimensions and want to know how they behave in service. “Enter under AC” if the function in service is specified and you are looking for the production dimensions.
Moulded part and reference part are made of different materials.	Select a separate application condition for the fit reference part (section 5.2, step 3).
I want to change the application condition or tolerance group later.	Use the pencil symbol in the respective box of the project view. All dimensions are recalculated immediately.
Different conditions apply to a single dimension.	When entering the dimension, select an “additional application condition (for the current measurement)”.
What does the warning triangle next to the production dimensions mean?	This tolerance series has to be agreed with the manufacturer of the moulded part.